



Spis treści / Table of contents

Cutting and drilling.....	p.2
Adhering and connecting LED strips.....	p.3
Attaching covers and end caps.....	p.4
Sealing the extrusion.....	p.5
Connecting extrusions using ZM connectors.....	p.6

- 1.** Before cutting the extrusion with the cover, secure the cutting point with self-adhesive tape.

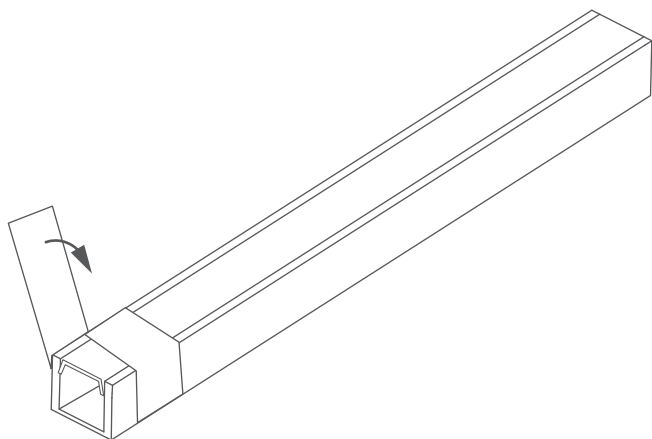


NOTE! Low precision cutting of the extrusion and cover can be done with a hand saw, however, uneven, jagged edges will remain, and the covers may break.

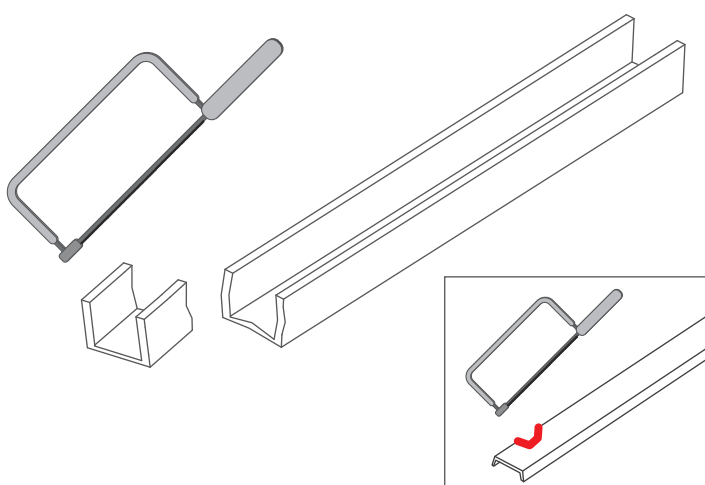

- 2.** Use a mechanical saw to cut.


NOTE! It is recommended that the cover be cut 2 mm shorter than the extrusion to account for its thermal expansion.

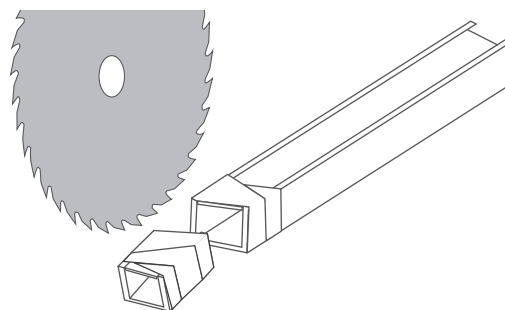

- 2mm




NOTE! For some extrusions there are dedicated end caps that require adequate shortening of the cover.

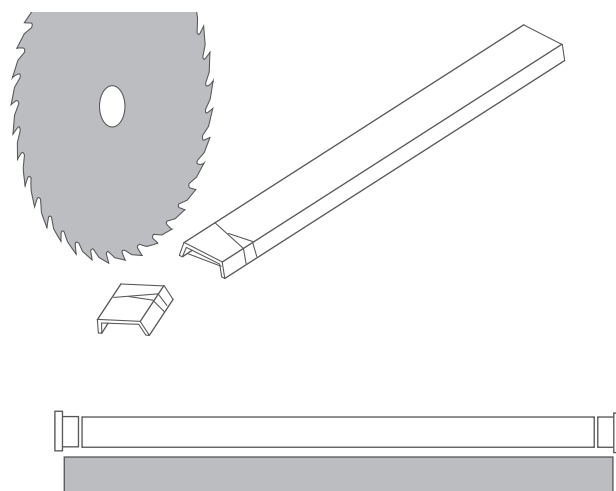


- 3.** Drill a hole in the extrusion in the selected place.


NOTE! Make sure that there are no burrs around the hole after drilling as they can damage the LED strip or cable.

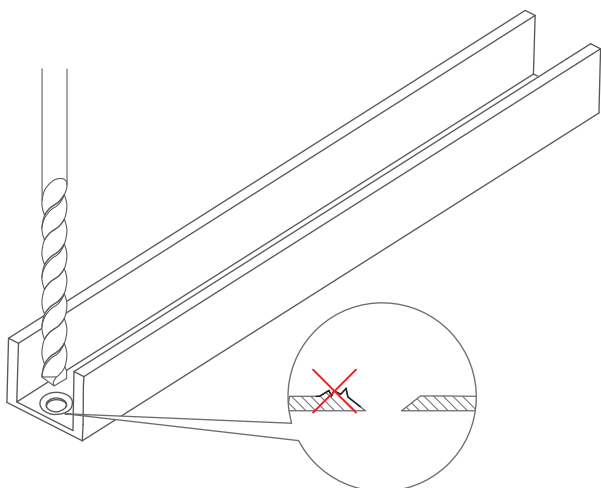

NOTE! Some extrusions feature one or more special grooves that make it easier to start drilling.

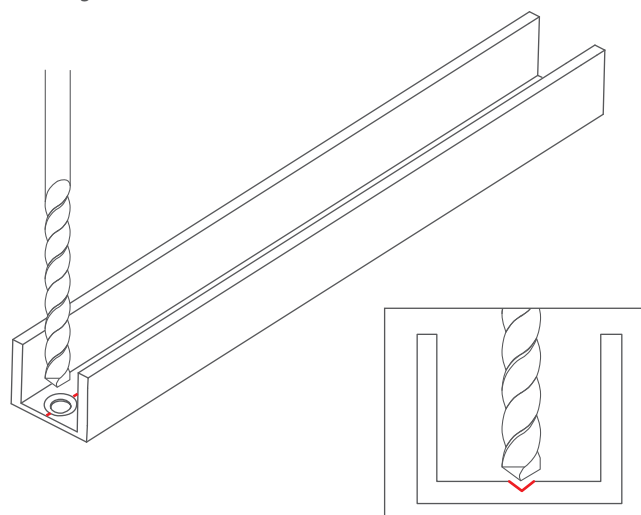


1. Remove the protective layer of the LED strip.

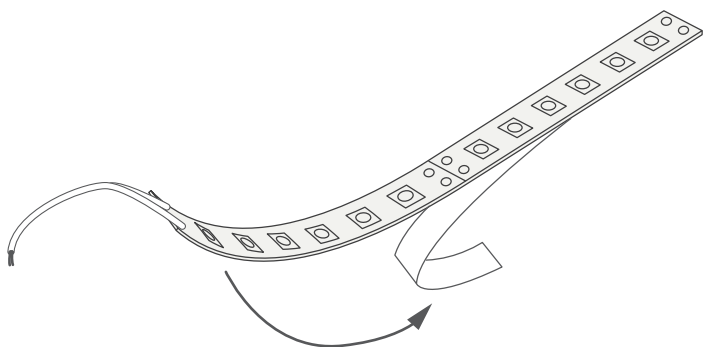


2. Attach the tape in the extrusion using the adhesive provided on the LED strip.


NOTE! The tape must not be bent or peel off the surface.

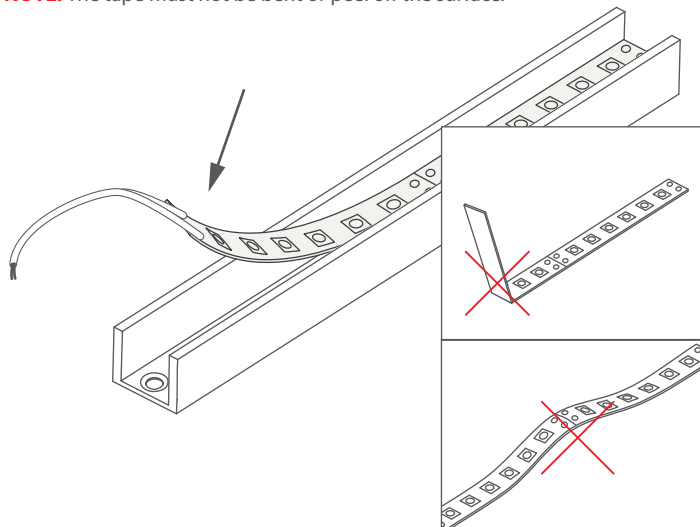


3. Lead the power cable through the drilled hole.

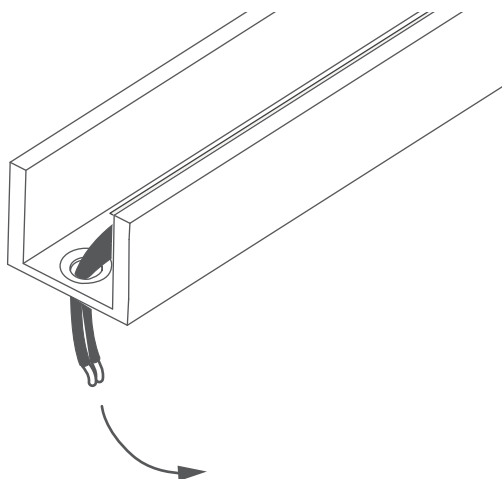


4. Connect the LED strips with wires by soldering.

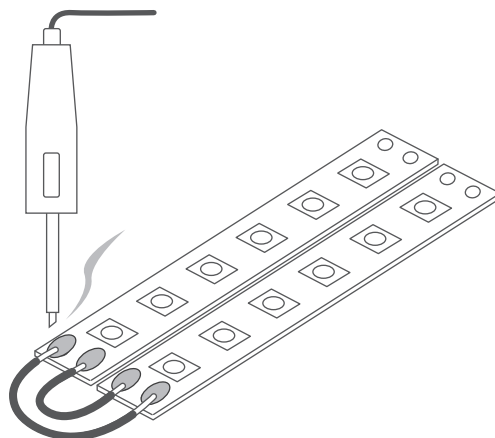


OPTIONALLY: The LED strips can also be connected using a system of LED strip connectors. More information at www.klusdesign.eu

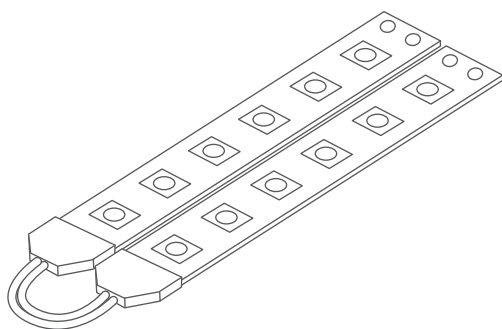


OPTIONALLY: The power cords can be led out from one pole of a given strip. This method is used to power suspended lighting fixtures.

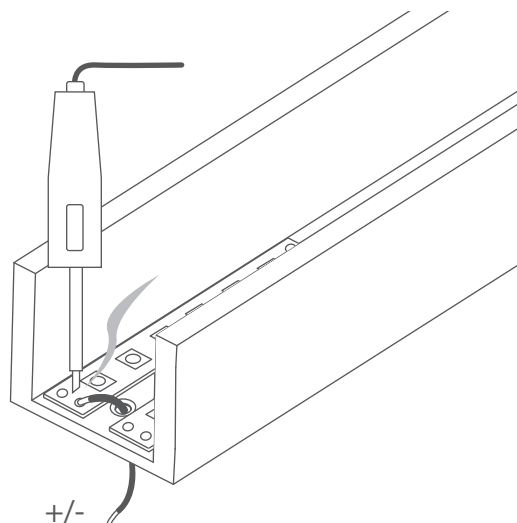


1. Insert the tip of the cover into the extrusion.

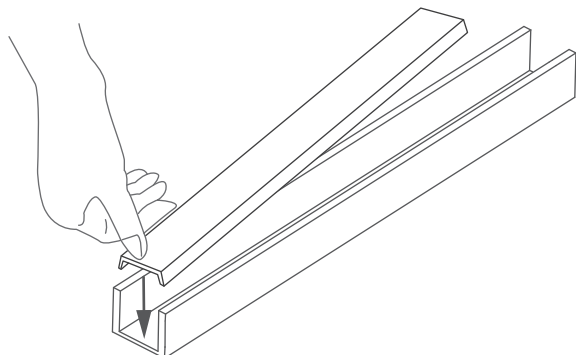

2. Press in the subsequent sections of the cover. Be careful not to bend or break the wings of the cover.

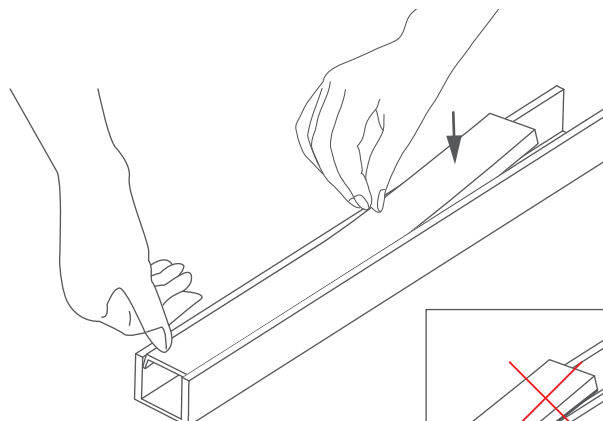


OPTIONALLY: Short sections, can also be inserted from the edge of the extrusion.

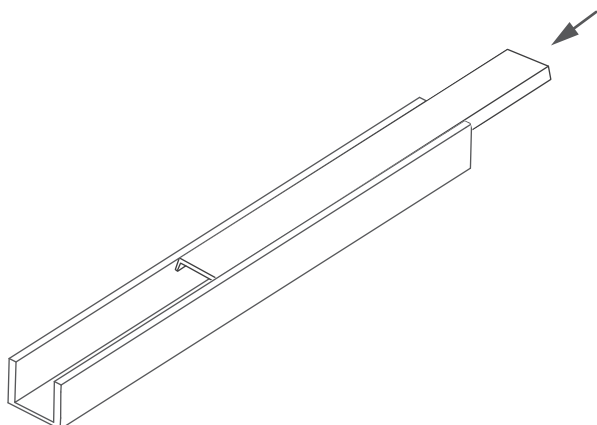


3. Insert an end cap into the edge of the extrusion. Individual extrusions have a shape that allows easy installation of dedicated end caps.


NOTE! Some end caps require an adequately shortened cover. This should be taken into account when cutting the extrusion and the cover.

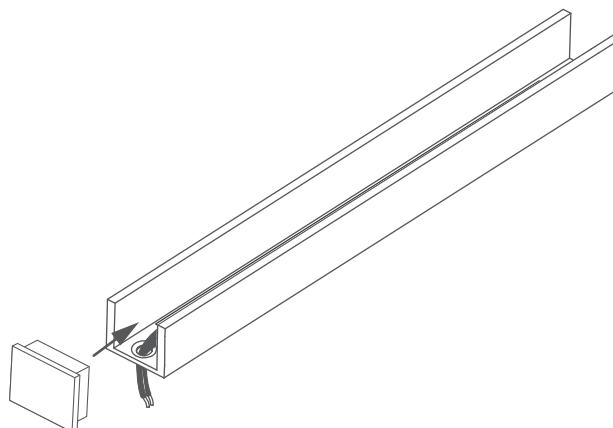


OPTIONALLY: The end caps can be attached to the extrusion using glue.

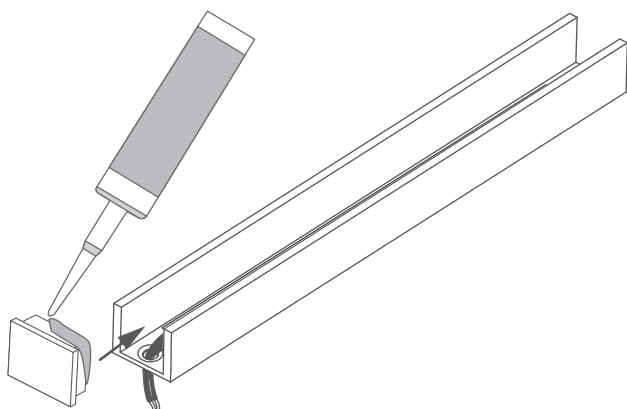


OPTIONALLY: Power cables can be run through the end caps in which case the extrusion does not need to be drilled through.

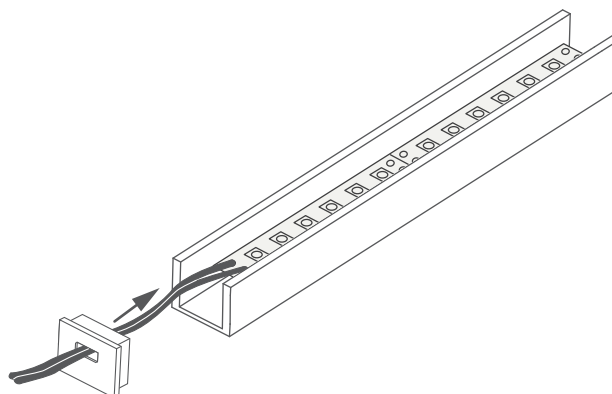

1. Clean dust and dirt from the extrusion and accessories.

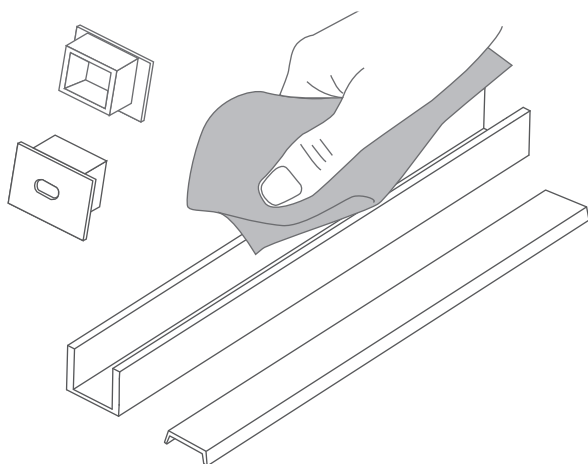


2. Attach the end caps with glue.

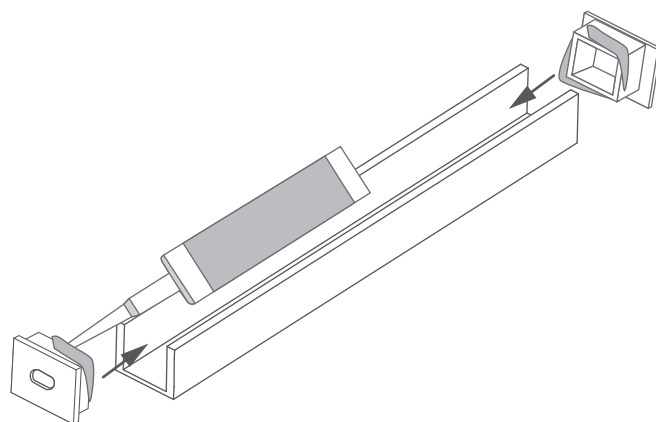


3. Apply a silicone layer to the bottom of the profile and embed the LED strip in it.


NOTE: The LED strip must have separate protection against moisture. We recommend a silicone sleeve or heat shrink tubing if the strip in the sleeve does not fit into the extrusion.

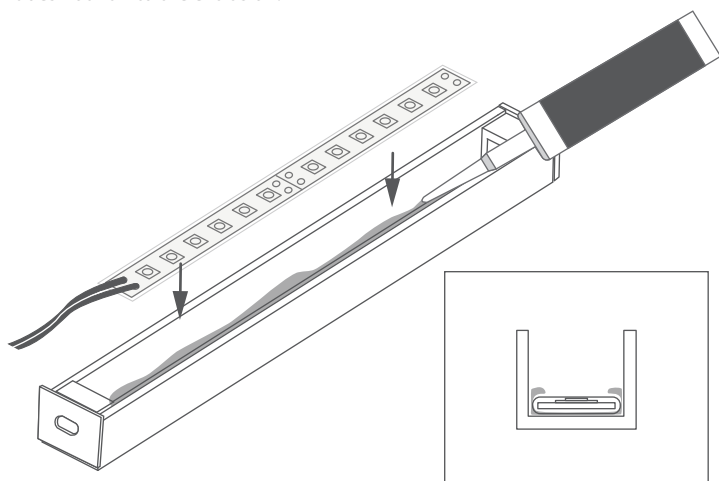


4. Apply a second layer of silicone on the extrusion walls and the end caps.

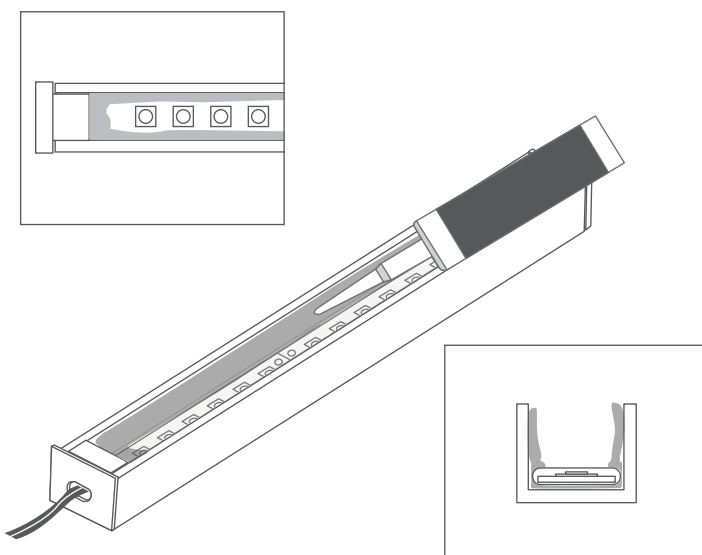


5. Remove the excess silicone with a rectangular tool (e.g. a piece of cardboard), taking care not to damage the tape. The silicone layer must be even and must not obscure the LEDs.

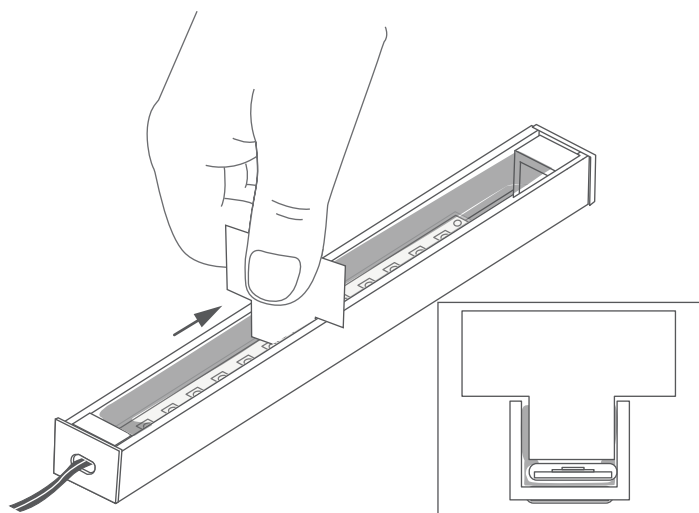


6. Insert the cover.

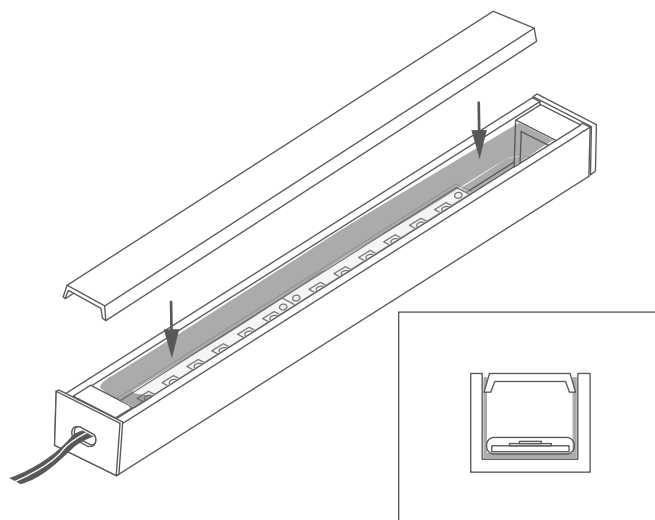

1. Slide the connectors into the small locks of the extrusion.

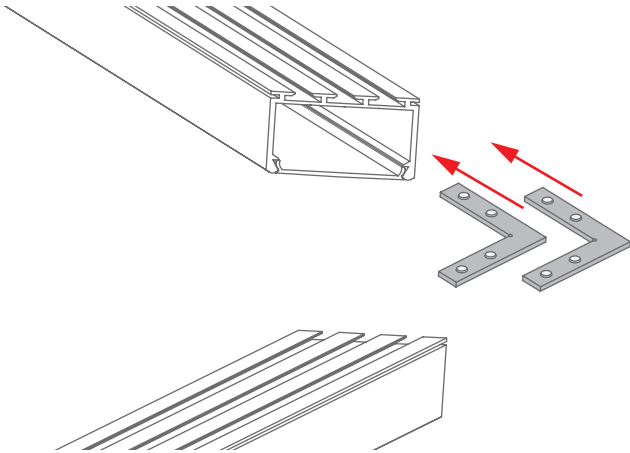

2. Tighten the two pressure screws in each connector with an Allen wrench.

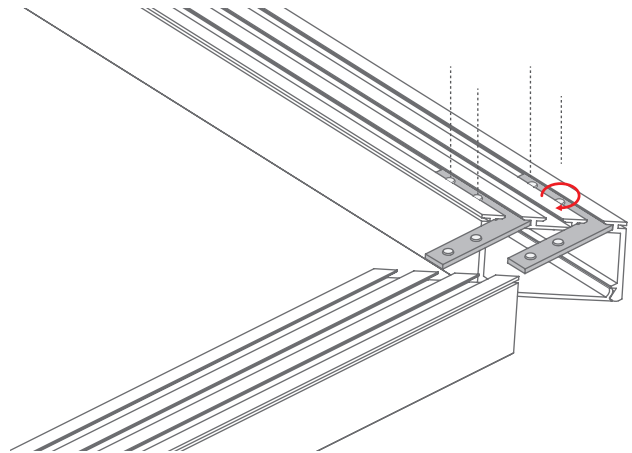

3. Slide the other half of the extrusion onto the connectors and tighten the pressure screws with an Allen wrench.

